



NVIDIA Quadro Professional Drivers *Release 169 Notes*

Version 169.55

For Windows XP / 2000

Windows XP Professional x64 Edition

Windows Server 2003 x64 Edition

NVIDIA Corporation
June 24, 2008

Published by
NVIDIA Corporation
2701 San Tomas Expressway
Santa Clara, CA 95050

Notice

ALL NVIDIA DESIGN SPECIFICATIONS, REFERENCE BOARDS, FILES, DRAWINGS, DIAGNOSTICS, LISTS, AND OTHER DOCUMENTS (TOGETHER AND SEPARATELY, "MATERIALS") ARE BEING PROVIDED "AS IS." NVIDIA MAKES NO WARRANTIES, EXPRESSED, IMPLIED, STATUTORY, OR OTHERWISE WITH RESPECT TO THE MATERIALS, AND EXPRESSLY DISCLAIMS ALL IMPLIED WARRANTIES OF NONINFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE.

Information furnished is believed to be accurate and reliable. However, NVIDIA Corporation assumes no responsibility for the consequences of use of such information or for any infringement of patents or other rights of third parties that may result from its use. No license is granted by implication or otherwise under any patent or patent rights of NVIDIA Corporation. Specifications mentioned in this publication are subject to change without notice. This publication supersedes and replaces all information previously supplied. NVIDIA Corporation products are not authorized for use as critical components in life support devices or systems without express written approval of NVIDIA Corporation.

Trademarks

NVIDIA, the NVIDIA logo, 3DFX, 3DFX INTERACTIVE, the 3dfx Logo, STB, STB Systems and Design, the STB Logo, the StarBox Logo, NVIDIA nForce, GeForce, NVIDIA Quadro, NVDVD, NVIDIA Personal Cinema, NVIDIA Soundstorm, Vanta, TNT2, TNT, RIVA, RIVA TNT, VOODOO, VOODOO GRAPHICS, WAVEBAY, Accuvision Antialiasing, the Audio & Nth Superscript Design Logo, CineFX, the Communications & Nth Superscript Design Logo, Detonator, Digital Vibrance Control, DualNet, FlowFX, ForceWare, GIGADUDE, Glide, GOFORCE, the Graphics & Nth Superscript Design Logo, Intellisample, M-BUFFER, nfiniteFX, NV, NVChess, nView, NVKeystone, NVOptimizer, NVPinball, NVRotate, NVSensor, NVSync, the Platform & Nth Superscript Design Logo, PowerMizer, Quincunx Antialiasing, Sceneshare, See What You've Been Missing, StreamThru, SuperStability, T-BUFFER, The Way It's Meant to be Played Logo, TwinBank, TwinView and the Video & Nth Superscript Design Logo are registered trademarks or trademarks of NVIDIA Corporation in the United States and/or other countries. Other company and product names may be trademarks or registered trademarks of the respective owners with which they are associated.

Intel, Indeo, and Pentium are registered trademarks of Intel Corporation. Microsoft, Windows, Windows NT, Windows Vista, Direct3D, DirectDraw, and DirectX are trademarks or registered trademarks of Microsoft Corporation. OpenGL is a registered trademark of Silicon Graphics Inc. PCI Express, PCI-SIG, and the PCI-SIG design marks are registered trademarks and/or service marks of PCI-SIG.

Other company and product names may be trademarks or registered trademarks of the respective owners with which they are associated.

Copyright

© 2008 by NVIDIA Corporation. All rights reserved.

Table of Contents

1. Release 169 Notes Introduction

Structure of the Document	1
Changes in this Edition.	1

2. Changes in the Release 169 Driver for Windows XP

Version 169.55 Highlights	3
What's New in Release 169	3
What's New in Version 169.55.	3
Special Instructional Notes for this Release	4
Turning Off V-Sync to Boost Performance	4
NVIDIA Application Configuration Engine (ACE)	4
Changes in Version 169.55	5
Fixed Issues–Windows XP 32-bit	5
Fixed Issues–Windows XP 64-bit	5
Changes in Version 169.47	7
Fixed Issues–Windows XP 32-bit	7
Fixed Issues–Windows XP 64-bit	8
Fixed Issues–Windows Server 2003	8
Open Issues in Version 169.55	9
NVIDIA Recommendations	9
Windows XP 32-bit Issues.	10
Windows XP 64-bit Issues.	13
Windows 2003 Server.	13
Not NVIDIA Issues.	14
Application Issues.	14
Known Product Limitations	15
Quad-Buffered Stereo Limitations	16
SLI Connector Requirement on NVIDIA Quadro	
SLI Cards	16
DVD Playback Issues with Dual NVIDIA Quadro	
NVS Cards	16
PowerDVD 5.0 Does Not Display Correctly in	
nView Span Mode	16
DirectX Fails When Detaching/Reattaching	
Displays in Dualview Mode.	17
OpenGL Viewport Scaling Problem in Horizontal	
Span Mode	17
Driver Reports 256 MB Memory on NVIDIA	
Quadro FX 330 Cards	17
Video Playback in nView Clone and Span Modes	
18	
Monitor Ordering in the Windows Settings Page	
18	

Applying Workstation Application Profiles	19
No Antialiasing of 3DMark03 Image Quality	
Screen Captures	20
Windows XP/2000 Issue with Settings Tab	
Monitor Positioning	20
Antialiasing Problems With Certain Applications	
21	
Poor Quality S-Video Output on Some TVs.	21
AGP and PCI-E Programs May Hang With AMD	
K7 and K8 Processors	21
Desktop Manager Does Not Re-Center Logon	
Screen	22
Issues with Video Mirror–Windows XP/2000	22

3. Release 169 Driver for Windows XP

Hardware and Software Support	24
Supported Operating Systems.	24
Supported NVIDIA Products.	25
Supported Languages.	26
Driver Installation	27
System Requirements.	27
Installation Instructions.	27
NVIDIA Driver History	30

A. Mode Support for Windows

General Mode Support Information.	32
Default Modes Supported by GPU for Windows XP	
33	
Understanding the Mode Format	33
NVIDIA Quadro FX Family of High End GPUs	
34	
NVIDIA Quadro FX Family of GPUs	41
TV-Out Modes Supported by TV Encoders	47

CHAPTER

1

Release 169 Notes **Introduction**

This edition of *Release 169 Notes* describes the Release 169 ForceWare Graphics Drivers for Microsoft® Windows® XP. NVIDIA provides these notes to enable add-in-card (AIC) producers and original equipment manufacturers (OEMs) to monitor performance improvements and bug fixes in each documented version of the driver.

Structure of the Document

This document is organized in the following sections:

- [“Changes in the Release 169 Driver for Windows XP” on page 2](#) gives a summary of changes, and fixed and open issues in this version.
- [“Release 169 Driver for Windows XP” on page 24](#) describes the NVIDIA products and languages supported by this driver, the system requirements, and how to install the driver.
- [“Mode Support for Windows” on page 31](#) lists the default resolutions supported by the driver.

Changes in this Edition

This edition of the *Release 169 Notes* for Windows XP includes information about NVIDIA ForceWare graphics driver version 169.55, and lists changes made to the driver since version 169.39. These changes are discussed beginning with the chapter [“Changes in the Release 169 Driver for Windows XP” on page 2](#).

CHAPTER

2

Changes in the Release 169 Driver for Windows XP

This chapter describes open issues for version 169.55, and resolved issues and driver enhancements for versions of the NVIDIA Release 169 driver up to version 169.55. The chapter contains these sections:

- “Version 169.55 Highlights” on page 3
- “Special Instructional Notes for this Release” on page 4
- “Changes in Version 169.55” on page 5
- “Changes in Version 169.47” on page 7
- “Open Issues in Version 169.55” on page 9
- “Known Product Limitations” on page 15

Version 169.55 Highlights

This section provides highlights of version 169.55 of the Release 169 Driver.

What's New in Release 169

- Added support for 3-way SLI technology.
- Improved compatibility and performance for NVIDIA SLI™ technology on Microsoft® DirectX® 9.0c and OpenGL® 2.1 applications.
- Added driver support for the following NVIDIA Quadro products:
 - NVIDIA Quadro FX 3700

What's New in Version 169.55

Resolved Issues for Windows XP

See ["Changes in Version 169.55"](#) on page 5 for a list of resolved issues.

Special Instructional Notes for this Release

This section clarifies certain features and controls.

Turning Off V-Sync to Boost Performance

To get the best benchmark and application performance measurements, turn V-Sync off as follows:

- 1 Open the NVIDIA Control Panel and enable **Advanced View**.
- 2 In the 3D Settings category, click **Manage 3D Settings**.
- 3 From the Global presets pull-down menu, select **Custom** and then click **Apply**.
- 4 From the Settings listbox, select **Vertical sync** and change its value to **Force off**, then click **Apply**.
- 5 From the Global presets pull-down menu, select **3D App - Default Global Settings** (the driver's default profile) or use the application profile that matches the application you are testing, then click **Apply**.

Be sure to close the NVIDIA Control Panel completely—leaving it open will affect benchmark and application performance.

NVIDIA Application Configuration Engine (ACE)

Driver versions 162.67 and higher for Windows XP include the NVIDIA Application Configuration Engine (ACE)¹.

With this feature, the graphics driver can now detect supported workstation applications and apply the appropriate profile settings automatically—you no longer need to manually select the profile from the NVIDIA Control Panel. If you run more than one application at a time, ACE makes sure that the driver applies the appropriate profile settings to each application.

See the *NVIDIA Quadro Professional Drivers Control Panel Quick Start Guide* for more information about NVIDIA ACE.

1. ACE has been supported under Window Vista in previous driver releases.

Changes in Version 169.55

The following sections describe changes made and issues resolved since driver version 169.47. Descriptions begin with the NVIDIA bug number as a reference.

- “Fixed Issues–Windows XP 32-bit” on page 5
- “Fixed Issues–Windows XP 64-bit” on page 5

Fixed Issues–Windows XP 32-bit

Single-GPU Issues

- The `GL_UNSIGNED_INT_10_10_10_2` format performance is slow.
- In Dualview mode, with Multiple Display Performance Mode from the NVIDIA Control Panel Manage 3D Settings page selected, tile ray-tracing renders incorrectly.
- Added Cadceus to the list of workstation application profiles.
- Added the following Avid applications to the list of workstation application profiles:
 - Media Composer
 - NC Adrenaline
 - Newscutter XP
 - Symphony
- Quadro FX 5600: QuickTime, After Effects plug-in Color Finesse 2 - the plug-in crashes in QuickTime while its UI is initialized.
- NVIDIA Quadro 4400: OpenGL hardware acceleration is disabled after enabling three monitors.
- Quadro FX 3700: CATIA v5r18– the application crashes occasionally when displaying a capture.
- Quadro FX 3700/1700, Dual-link display: Out-of-sync scan lines appear on the monitor connected to the upper DVI connector when running `dxdiag.exe`.
- NVIDIA Quadro FX 3500: Poser 7– performance is poor with OpenGL hardware shading enabled.
- Quadro FX 1700: CATIA – drawing grid is displayed incorrectly.

Fixed Issues–Windows XP 64-bit

Single-GPU Issues

- Quadro FX 1600: CATIA v5r (32-bit) – image rendering on section cut is corrupt.]

- Quadro FX 1700: The system hangs when DDC calls are used to access the display.
- Quadro FX 1700: CATIA – drawing grid is displayed incorrectly.

Changes in Version 169.47

The following sections describe changes made and issues resolved since driver version 169.39. Descriptions begin with the NVIDIA bug number as a reference.

- “Fixed Issues–Windows XP 32-bit” on page 7
- “Fixed Issues–Windows XP 64-bit” on page 8
- “Fixed Issues–Windows Server 2003” on page 8

Fixed Issues–Windows XP 32-bit

Single-GPU Issues

- 169.61: Memory leak in nvoglnt.dll.
- ProductView exhibits initialization instability with newer NVIDIA Release 169 drivers.
- Multiple calls to `glTexSubImage2d()` from a pixel buffer object results in red/green channel inversion.
- NVIDIA Quadro FX, Maya 2008 Gold: Hardware renderer crashes on “High Quality” setting.
- NVIDIA Quadro FX 3700: Performance regression with uploads and readbacks compared with Release 169.32.
- 169.39: Clicking System Information in the NVIDIA Control Panel gives an error or no information.
- Workstation: Under Dualview mode, OpenGL applications crash—Softimage, Maya, SolidWorks, I-DEAS, Solid Edge.
- 169.39: `WGL_NV_gpu_affinity` extension in Dualview causes access violation.
- Workstation: SPECviewperf9 has a performance regression.
- NVIDIA Control Panel 3D profile for Avid Softimage | XSI downgrades `GL_VERSION` string to 1.2.
- NVIDIA Quadro FX 5500, Maya 6.5: There is a performance drop with the 169.61 driver.
- NVIDIA Quadro FX 350[/5500], Catbench 2004 R18 0: There is a performance drop with driver 169.61.
- Add additional binaries to the Driver Application Profile list that enables Quadro Direct3D performance optimizations.
- 169.xx, Fusion Learning 5.21: Calling `wglMakeCurrent()` causes crash in `nvogl32.dll` with recent NVIDIA drivers.
- NVIDIA Quadro FX 5600, SolidWorks2008 SP0: There is corruption when zooming in and out with Appearance Callout and RealView Graphics active.

- NVIDIA Quadro FX 350M[/3500], SolidWorks 2008: Model edges are not depth buffered if RealView and Shadows are disabled when there is a solid background.
- Please add Side Effects Houdini to the list of programs in the NVIDIA Control Panel Manage 3D Settings section.
- Dualview rendering error with pixel buffers.
- Hardware antialiasing renders incorrectly when initialized from a pixel buffer.
- NVIDIA Quadro FX 5600, ICEM Surf: With soft shadows enabled, the shadows on one Dualview display are rendered incorrectly.
- Avid Media Composer has texture corruption during multithreading.
- G80: Multigen Vega Prime has a performance loss on NVIDIA G80-based cards.

Fixed Issues—Windows XP 64-bit

Single-GPU Issues

- NVIDIA Quadro FX 3700, Workstation: Autodesk Opticore Realizer 2008 hangs when running the application on the secondary Dualview display.
- ProductView exhibits initialization instability with newer NVIDIA Release 169 drivers.
- 169.30, NVIDIA Quadro FX 3700[/4500]: Large memory leak with Opticore Realizer 2008.
- 169.39: Clicking System Information in the NVIDIA Control Panel gives an error or no information.
- 169.39: No Autodesk Maya preset configuration.
- Workstation: SPECviewperf9 has a performance regression.
- 169.61, Maya 2008: Various hangs and crashes when automated regression and performance tests are running.
- Primitive colors draw more slowly than even randomly assigned point colors.
- Pixel buffer object transfer very slow with 169.xx drivers.

Fixed Issues—Windows Server 2003

Single-GPU Issues

- Multithreading hangs and crashes in OpenGL with NVIDIA 162 and 169 drivers.

Open Issues in Version 169.55

As with every released driver, version 169.55 of the Release 169 driver has open issues and enhancement requests associated with it. This section includes lists of issues that are either not fixed or not implemented in this version. Some problems listed may not have been thoroughly investigated and, in fact, may not be NVIDIA issues. Others will have workaround solutions.

They are listed in the following sections:

- [“NVIDIA Recommendations” on page 9](#)
- [“Windows XP 32-bit Issues” on page 10](#)
- [“Multi-GPU Issues” on page 11](#)

NVIDIA Recommendations

- Single display modes such as TV only, DFP/LCD only or CRT only provide the best performance and quality from Windows Media Center Edition.

Dual display modes such Dualview and nView Clone and Span modes are not recommended.

- When using the trial version of WinDVD 6 from InterVideo.com, you may experience TV or DVD playback problems in Windows Media Center if you change resolutions during video playback. This is most often seen when switching from windowed to full screen mode.

This problem does not occur with the latest full OEM versions of WinDVD or with other Windows Media Center qualified DVD decoders.

- If you perform a clean driver installation (no previous NVIDIA drivers installed), *you must reboot your computer*. If you do not reboot, the predefined application profiles will not be activated and you may experience application stability problems.

Windows XP 32-bit Issues

This section includes issues that occur under Windows XP or Windows 2000:

Single-GPU Issues

- Rendering speed remains slow after closing resource-intensive applications.
- NVIDIA Control Panel->Workstation-> Frame Sync: The View Status Page does not detect which is the first and which is the second display attached to the GPU.
- Video color-space range for DVI-only¹ outputs is erroneously set to standard mode (16-235) instead of extended mode (0-255).

A new detection feature to apply Standard CSC mode to TV outputs (including NTSC, PAL, 480i, and 576i), included DVI-only outputs by mistake.

Note: *The driver correctly applies extended mode to analog outputs, and standard mode to TV outputs (including NTSC, PAL, 480i, and 576i).*

A future driver release will correct this and apply the extended-mode color space to DVI-only outputs.

You can work around this issue by forcing either standard or extended mode as follows:

- 1 Launch **regedit** and identify the current primary display card by looking in

HKey_Local_Machine\Hardware\DeviceMap\Video

and note the GUID (global unique identifier assigned by Windows), which is the long string in brackets { } at the end of the entry

"\device\video0".

- 2 Look in

HKey_Local_Machine\SYSTEM\CurrentControlSet\Control\Video\{GUID}\0000

where {GUID} is the number derived from the previous step.

- 3 Open the "0000" directory and create a new DWORD called **VMRCCCSStatus** and give it a value of

0x3 - to force use of the standard YUV range of 16-235

0x1 - to force use of the extended YUV range of 0-255

- OpenGL application freezes when running two threads that both use FBOs.
- Mixing an OpenGL window with a Windows Presentation Foundation (WPF) application interface results in flickering.
- GetAvailableVidMem() call does not work correctly.
- DeltaGen v7.0: Generated modules do not render properly when moved to the other Dualview display.

1. "DVI-only" means only one display is connected, and it is to the DVI output.

- NVIDIA Quadro FX 5600: The timings for high custom resolutions, such as 4096x1080, are incorrect until the NVIDIA Control Panel is opened.
- NVIDIA Quadro FX 5600: The NVIDIA Control Panel custom resolution settings behave inconsistently.
- Quadro FX 5600: Rendering doesn't occur on the secondary Dualview display when using GPU affinity extensions.
- Quadro FX 5600: Running Maya and a DirectX applications at the same time results in paged pool memory errors.
- Quadro FX 5600: Picasso (using JDK)–window redraws are dropped or delayed.
- NVIDIA Quadro FX 4600: CADMEISTER performance is slower than when run on an NVIDIA Quadro FX 1500.
- Quadro FX 4600/1700: Memory corruption in n4v_disp.dll occurs when streaming video.
- Quadro FX 4600: With multiple cards installed, the maximum monitor resolution on all displays cannot be set.
- Quadro FX 4500/4600: Intergraph 4–there is a five-second delay whe loading Dynamic Zoom.
- NVIDIA Quadro G-Sync II, Quadro FX 4600: Black frame occurs every 8 seconds when using a video time-base as the sync source.
- Quadro FX 3700: Timing is not generated for 2048x2560 or 2560x2048 resolutions.
- Quadro FX 3500/4500: Window refreshes slowly if three stereo views are open and tracking cursor is enabled on both auxiliary views.
- Quadro FX 1500/3450/4000: GoCAD–there are invalid “No Data Pixel” textures.
- Quadro FX 1500/1700/3700: I-DEAS – memory errors occur when working with large assemblies
- NVIDIA Quadro FX 3700: The driver is not allocating textures contiguously in video memory.
- NVIDIA Quadro FX 1700[/3700]: dCoder 2.0–the application crashes when opening a QuickTime movie.
- Quadro FX 570: Running an OpenGL application in Dualview mode results in high CPU useage.

Multi-GPU Issues

- SLI: With SLI mode enabled, the NVIDIA Control Panel > Workstation > View Status page does not the correct monitor connections.
- SLI, NVIDIA Quadro FX 4600[/5600]: Virtual Reality Editor–under SLI-AFR mode, the application's advanced mode rendering flickers.
- [Multi-GPU]: There is no application scaling when using glReadPixels() with GPU affinity.

- [Multi-GPU], Quadro FX 5600: Rendering into onscreen context with OpenGL is slow.

Windows XP 64-bit Issues

- There are missing files in the driver installation, which results in errors when trying to uninstall the driver.
- SolidEdge (32-bit)—the application cannot determine the driver version under a non-administrator account.
- Quadro FX 5600: CST Microwave Studio—blue-screen crash and runtime errors related to virtual memory occur after multiple simulation runs.
- Quadro FX 4600/5600: Maya—the display does not refresh properly.
- Quadro FX 3400: Memory use increases when rendering to p-buffers.
- Quadro FX 1700: thinkdesign—the application crashes after switching from wireframe to shading.
- Quadro FX 1500/3450/4000: GoCAD—there are invalid “No Data Pixel” textures.
- Quadro FX 570/1700: 169.32: Catnap corrupts the projection matrix for the Reflect OpenGL Demo.

Windows 2003 Server

- [Multi-GPU], Quadro FX 5600: Rendering into onscreen context with OpenGL is slow.

Not NVIDIA Issues

This section lists issues that are not due to the NVIDIA driver, or are not supported by the NVIDIA driver for Windows XP.

Application Issues

- Linear interpolation on a 3D texture with format `GL_RGBA32F_ARB` produces banding.
This is not an NVIDIA driver bug, but a normal result of the filtering methods used by the hardware.
- CATIA V5R18—there are no "Enable OpenGL Shader" options.
This is not an NVIDIA bug, but rather an issue with Windows XP SP2.
- Windows Vista 64-bit: XSI - the application viewport doesn't refresh properly.
This is not an NVIDIA bug, but rather an issue with the application.
- CATIAV5R18— Draft Analysis images are displayed incorrectly.
This is not an NVIDIA bug, but rather an issue with the application.

Known Product Limitations

This section describes problems that will not be fixed. Usually, the source of the problem is beyond the control of NVIDIA. Following is the list of problems and where they are discussed in this document:

- “Quad-Buffered Stereo Limitations” on page 16
- “SLI Connector Requirement on NVIDIA Quadro SLI Cards” on page 16
- “DVD Playback Issues with Dual NVIDIA Quadro NVS Cards” on page 16
- “PowerDVD 5.0 Does Not Display Correctly in nView Span Mode” on page 16
- “DirectX Fails When Detaching/Reattaching Displays in Dualview Mode” on page 17
- “OpenGL Viewport Scaling Problem in Horizontal Span Mode” on page 17
- “Driver Reports 256 MB Memory on NVIDIA Quadro FX 330 Cards” on page 17
- “Video Playback in nView Clone and Span Modes” on page 18
- “Monitor Ordering in the Windows Settings Page” on page 18
- “Applying Workstation Application Profiles” on page 19
- “No Antialiasing of 3DMark03 Image Quality Screen Captures” on page 20
- “Windows XP/2000 Issue with Settings Tab Monitor Positioning” on page 20
- “Antialiasing Problems With Certain Applications” on page 21
- “Poor Quality S-Video Output on Some TVs” on page 21
- “AGP and PCI-E Programs May Hang With AMD K7 and K8 Processors” on page 21
- “Desktop Manager Does Not Re-Center Logon Screen” on page 22
- “Issues with Video Mirror–Windows XP/2000” on page 22

Quad-Buffered Stereo Limitations

DDC VGA or blue-line 3D stereo hardware is not supported on Quadro cards based on the G8x series GPUs. This includes Quadro FX 370, 570, 1700, 4600, & 5600 products.

SLI Connector Requirement on NVIDIA Quadro SLI Cards

The SLI connector that links two SLI cards is needed for proper SLI operation. However, the connector can be removed if you do not intend to enable SLI mode. If you remove the connector, then you must make sure that SLI mode is disabled from the NVIDIA control panel. Enabling SLI mode without the SLI connector installed will result in video corruption.

DVD Playback Issues with Dual NVIDIA Quadro NVS Cards

With both AGP and PCI NVIDIA Quadro NVS cards installed in the system, when attempting to play DVDs in full-screen mode on the display connected to the PCI card, the screen is blank.

This is not an NVIDIA bug, but rather a problem with older point releases of PowerDVD and WinDVD.

PowerDVD 5.0 Does Not Display Correctly in nView Span Mode

With nView Horizontal Span mode enabled, when the PowerDVD 5.0 playback window is dragged to the second display and then stretched to fill the display, the right area of the display is corrupted.

This is not an NVIDIA bug, but a problem with PowerDVD.

DirectX Fails When Detaching/Reattaching Displays in Dualview Mode

This problem can be duplicated as follows:

- 1 Enable both displays in Dualview mode.
- 2 Detach monitor 2 and apply settings.
- 3 Reattach monitor 2 and apply settings.
DirectX runtime fails on monitor 1.

This is not an NVIDIA bug, but a limitation in the operating system where DirectX does not enumerate the second device. DirectX can be restored to both displays by rebooting the system

OpenGL Viewport Scaling Problem in Horizontal Span Mode

With nView Horizontal Span mode enabled, when opening an OpenGL model in a viewport, the model image is scaled too large to fit in the viewport. The problem occurs with such applications as Maya 5.0 and 3D Studio MAX 4.26.

This is not an NVIDIA bug, but a limitation in the application's ability to properly maintain the aspect ratio in Horizontal Span mode.

Driver Reports 256 MB Memory on NVIDIA Quadro FX 330 Cards

- **Problem**

When a 64 MB NVIDIA Quadro FX 330 card is installed, the driver reports that the card needs 256 MB, causing 256 MB of address space to be consumed.

- **Explanation**

This is not a bug but a product limitation.

The NVIDIA Quadro FX 330 GPU has some limitations that prevent the card from addressing less than 256 MB of system memory.

Video Playback in nView Clone and Span Modes

- **Problem**

With nView Clone or Span mode enabled, video playback appears on only one display under the following conditions:

- Under nView Clone mode, when full-screen video mirror is not used.
- Under nView Span mode, when full-screen video mirror is not used and the video is positioned to span across both monitors.

- **Explanation**

With applications that render using the hardware overlay—such as DirectX applications—the default driver behavior is to enable the hardware overlay when nView Clone or Span mode is enabled.

Because the driver supports only one hardware overlay, the video appears on only one display.

Monitor Ordering in the Windows Settings Page

Monitor Ordering on a Single GPU

- **Issue**

The monitor order in the Display Properties Settings page is not consistently matched with the connectors on the graphics card.

- **Explanation**

The driver does not distinguish connector positions, but instead distinguishes the display type, and consequently assigns monitor numbers according to the display type and not according to the connector.

Monitor Ordering on a Multiple GPU System

- **Issue**

When four monitors are connected to a system with multiple PCI GPUs, such as a NVIDIA Quadro NVS 400 graphics card, and enabled in Dualview mode, many customers expect the monitor ordering in the Display Properties Settings page to conform to the following:

Connector Position	Monitor Number
Primary GPU—Output 1	1
Primary GPU—Output 2	2

Connector Position	Monitor Number
Secondary GPU—Output 1	3
Secondary GPU—Output 2	4

The monitor ordering, in fact, does not conform to this scheme.

- **Explanation**

The monitor ordering is not controlled by the driver, but rather by the Windows OS method of enumerating PCI devices. The Windows enumeration results in the following monitor numbering:

Connector Position	Monitor Number
Primary GPU—Output 1	1
Secondary GPU—Output 1	2
Primary GPU—Output 2	3
Secondary GPU—Output 2	4

Considerations for nView Span Modes: Outputs from the same GPUs are grouped together in nView Span modes, resulting in the desktop spanning across monitors 1 and 3, or across 2 and 4.

Applying Workstation Application Profiles

- **Application Profiles Should be Used**

The workstation application profiles are software settings used by the NVIDIA Display Drivers to provide optimum performance when using a selected application. The profile also works around known application issues and bugs.

If there is an available setting for an application, it should be used, otherwise incorrect behavior or reduced performance is likely to occur.

- **Applying Application Profiles**

If you make a configuration change while the application is open, you must exit and then re-open the application for the change to take effect.

When an application is running it does not receive notification of configuration changes.

No Antialiasing of 3DMark03 Image Quality Screen Captures

- **Problem**

After enabling antialiasing from the NVIDIA Properties page, 3DMark03 screen captures—obtained using the application’s screen capture function—might not be antialiased.

- **Explanation**

This is not an NVIDIA bug, but rather a result of different methods used to render antialiased images.

Depending on a combination of factors, the driver may take advantage of the NVIDIA hardware’s ability to bypass the front buffer while rendering an antialiased image. In this case, the front buffer does not contain antialiased data, so if an application takes data from the front buffer—as is the case with 3DMark03’s Image Quality screen captures—then the resulting image is not antialiased.

To accommodate applications that request use of the front buffer, the NVIDIA software can provide the antialiased data in a buffer to the application. Since this negates the advantages of the NVIDIA hardware capability, this support is enabled only when antialiasing is enabled within the application, and not from the NVIDIA control panel.

In all cases when antialiasing is enabled, screen images as well as screen captures obtained using the Print Screen key are always antialiased.

Windows XP/2000 Issue with Settings Tab Monitor Positioning

- **Problem**

In the Windows **Display Properties > Settings** tab, the secondary monitors cannot be positioned directly above monitor #1 without snapping horizontally to a position diagonal to monitor #1.

- **When the Problem Occurs**

The problem occurs when four monitors are connected to the graphics adapter card, but only two of them are enabled.

- **Cause and Workaround**

This is a Microsoft—not an NVIDIA—bug, and there is no workaround to correct the positioning of the monitor icons. However, the actual positioning of the displays on the desktop can be corrected using the nView Desktop Manager window as follows:

- 1 Under the Tools tab in the Desktop Manager windows, make sure Automatically Align Displays is checked.

- 2 In the **Settings** tab, position the appropriate monitor icon above monitor #1, then click **Apply**.

The mouse cursor movement between monitor desktops will correspond to a vertical orientation of the monitors, even though the monitor icons in the **Settings** tab are diagonal to each other.

Note: This will be the case even if the monitor icons are deliberately positioned diagonal to each other.

Antialiasing Problems With Certain Applications

Antialiasing in the NVIDIA Direct3D driver requires each new frame to be rendered from scratch. This requirement adversely affects applications that render only that portion of the content that has changed since the last frame. A common symptom of this problem is geometric structures that incorrectly disappear and re-appear as the scene shifts.

Poor Quality S-Video Output on Some TVs

NVIDIA drivers differentiate an S-video TV from a composite TV by searching for 75-Ohm loads on the chrominance and luminance lines. If the driver detects only one such load, it assumes that it has a composite TV and drives both chroma and luma onto that line. This approach allows both types of TV to display in color.

Unfortunately, some S-video TVs do not apply the correct load to both lines, causing the driver to detect an S-video TV as a composite. The driver, in turn, sends the lower quality signal to the S-video TV. To work around this problem, use the Control Panel to override the **Auto-select** feature. This can be done following these steps:

- 1 In the **Settings** tab of the **Display Properties** Control Panel, click **Advanced**.
- 2 In the **nView** tab, click **Device Settings** and click **Select Output Device**.
- 3 In the **Device Selection** tab, click the **TV** option.
- 4 Change the **Video output format** to **S-video**.

AGP and PCI-E Programs May Hang With AMD K7 and K8 Processors

- **Issue**

Microsoft® Windows® 2000 and Windows XP systems using AMD K7 and K8 processors can hang when an AGP or PCI-E program is used.

- **Root Cause**

There is a known problem with Microsoft® Windows® 2000 and Windows XP systems using AMD K7 and K8 CPUs that results in the Microsoft

operating system allocating overlapping 4M cached pages with 4k write-combined pages. This condition results in undefined behavior and data corruption, and is explicitly disallowed by the AMD CPU manual.

This problem can affect any device driver in the system that allocates write-combined system memory, but is usually most easily reproduced with graphics drivers since graphics drivers generally make heavy use of write-combined system memory for performance reasons.

- **Resolution**

Microsoft has a knowledge base article on the issue, the text of which is unfortunately quite outdated. While the article only mentions Windows 2000, AGP, and K7, both the root cause and resolution also apply to Windows 2000 or Windows XP, AGP or PCI-E, and AMD K7 or K8. The article can be found at <http://support.microsoft.com/?id=270715>.

The issue is resolved by applying an operating system registry key as described in the referenced article that instructs the Microsoft operating system to not use the 4M pages, thus avoiding the conflict.

The registry key is automatically applied by installation of the latest NVIDIA nForce platform driver package (including 4.57 SMBUS or later). It is imperative for the package to be installed or for the registry key to be applied before the NVIDIA graphics driver or any other device drivers are installed. The registry key takes effect only after an operating system reboot.

Desktop Manager Does Not Re-Center Logon Screen

On Windows XP multi-display systems that are set to nView Span mode, the Windows logon screen is centered on the extended desktop. This usually causes it to be split across two displays, which users may find annoying. Although users can normally use the Desktop Manager to restrict a window's appearance to one display, security restrictions in the operating systems prevent this in the case of the logon screen.

Issues with Video Mirror—Windows XP/2000

Table 2.1 lists current known issues with NVIDIA Video Mirror functionality.

Table 2.1 Known Issues with Video Mirror

Video Mirror is not yet implemented for applications using Video Port Extensions (VPE).
If Video Mirror is enabled but a full-screen display does not appear, one of the following problems may have occurred:
Video Mirror can only function when overlay is being used. The video player may not be able to create an overlay if another application is using the overlay, or the desktop display resolution is too high. You can lower the desktop resolution, pixel depth, or refresh rate.

Table 2.1 Known Issues with Video Mirror (continued)

Video Mirror requires some extra memory to run. Try closing other DirectX or OpenGL applications that may be running.
You may need to close and restart your video application for Video Mirror enabling or disabling to take effect.
Some video players that cannot detect the presence of Video Mirror stop playing if they are minimized or completely obscured by another window. For example, Media Player can exhibit this problem.

CHAPTER

3

Release 169 Driver for Windows XP

This chapter covers the following main topics:

- “Hardware and Software Support” on page 24
- “Driver Installation” on page 27
- “NVIDIA Driver History” on page 30

Hardware and Software Support

Supported Operating Systems

This Release 169 driver includes drivers designed for the following Microsoft® operating systems:

- Microsoft Windows® XP
 - Windows XP Professional
 - Windows XP Home Edition
 - Windows XP Professional x64 Edition
- Microsoft Windows Server 2003 x64 Edition¹
- Microsoft Windows 2000

1. SLI mode is not supported under Microsoft Windows Server 2003 x64.

Supported NVIDIA Products

Table 3.1 lists the NVIDIA workstation products supported by this Release 169 driver.

Table 3.1 Supported NVIDIA Workstation Products

Product	Windows XP 32-bit Windows 2000	Windows XP Professional x64
NVIDIA Quadro FX 5600	X	X
NVIDIA Quadro FX 5500	X	X
NVIDIA Quadro FX 4600	X	X
NVIDIA Quadro FX 4500 X2	X	X
NVIDIA Quadro FX 4500	X	X
NVIDIA Quadro FX 4400	X	X
NVIDIA Quadro FX 4000	X	X
NVIDIA Quadro FX 3700	X	X
NVIDIA Quadro FX 3500	X	X
NVIDIA Quadro FX 3450	X	X
NVIDIA Quadro FX 3400	X	X
NVIDIA Quadro FX 3000	X	X
NVIDIA Quadro FX 2000	X	X
NVIDIA Quadro FX 1700	X	X
NVIDIA Quadro FX 1500	X	X
NVIDIA Quadro FX 1400	X	X
NVIDIA Quadro FX 1300	X	X
NVIDIA Quadro FX 1100	X	X
NVIDIA Quadro FX 1000	X	X
NVIDIA Quadro FX 700	X	X
NVIDIA Quadro FX 500/FX 600	X	X
NVIDIA Quadro FX 570	X	X
NVIDIA Quadro FX 560	X	X
NVIDIA Quadro FX 550	X	X
NVIDIA Quadro FX 540	X	X
NVIDIA Quadro FX 370	X	X
NVIDIA Quadro FX 350	X	X
NVIDIA Quadro FX 330	X	X
NVIDIA Quadro NVS 440	X	X
NVIDIA Quadro NVS 290	X	X
NVIDIA Quadro NVS 285 PCI-E	X	X
NVIDIA Quadro NVS 280	X	X

Supported Languages

The Release 169 NVIDIA Quadro Professional Drivers supports the following languages in the main driver Control Panel:

English (USA)	German	Portuguese (Euro/Iberian)
English (UK)	Greek	Russian
Arabic	Hebrew	Slovak
Chinese (Simplified)	Hungarian	Slovenian
Chinese (Traditional)	Italian	Spanish
Czech	Japanese	Spanish (Latin America)
Danish	Korean	Swedish
Dutch	Norwegian	Thai
Finnish	Polish	Turkish
French	Portuguese (Brazil)	

Driver Installation

System Requirements

The hard disk space requirement is minimum 62.9 MB for English-only, and 79 MB for International.

Installation Instructions

Before You Begin

- If you do not have System Administrator access privileges, it is assumed that the appropriate person with System Administrator access in your organization will set up and install the NVIDIA graphics driver software on your computer.
- The installation process copies all necessary files for operation into the appropriate directories.
- The nView system files are copied to your **Windows\System** directory.
- nView Desktop Manager Profile files (*.tvp) are saved in the **Windows\Nview** directory.

Depending on the version of the NVIDIA driver previously installed, profiles may also be located in the **Documents and Settings\All Users\Application Data\nView_Profiles** directory.

- As part of the install process, an uninstall is registered in your system.
- Under Windows XP, the NVIDIA driver is installed in “Dualview mode” display. However, note that the second display is not activated by default, but must be enabled.

Preserving Settings Before Upgrading Your Software

Before uninstalling or installing software, you can preserve your nView Desktop Manager and/or NVIDIA Display settings by using the nView Desktop Manager Profiles features.

Note: Follow the steps below and/or refer to the *NVIDIA nView Desktop Manager User's Guide* for details. Under Windows XP/2000 and Windows NT 4.0, you must have, at least, **Power User** access privileges in order to create or save a profile. (Refer to Windows Help if you need an explanation of Power User access rights.)

Follow the steps below and/or refer to the *NVIDIA nView Desktop Manager User's Guide* for details.

- 1 Open the nView Desktop Manager Profiles page (Figure 4.1).
- 2 To preserve your current settings, you can use either the **Save** or the **New** option from the nView Desktop Manager Profiles page:
 - If you want to overwrite the currently loaded profile with your changed settings, use the **Save** option. Notice that a warning message indicates that you are about to overwrite the selected profile.
 - If you want to retain the currently loaded profile and want to save your changed settings to a new file, click the **New** option. Enter a name and description of the profile in the New Profile dialog box. For example, you can name this profile **My Settings**.
- 3 If you are an "advanced" user and want to customize certain settings in the saved profile, click **Advanced** << to expand the dialog box (Figure 4.2).
- 4 To customize the settings, you can select or clear any of the settings check boxes.
- 5 Click **Save** to return to the main Profiles page.

If you created a new profile, you will see the name of the newly created profile in the profiles list.

If you overwrote a current profile, the same profile name is retained in the list.

Note: nView Desktop Manager profile (.tvp) files are saved in the **Windows\nView** directory. Depending on the version of the NVIDIA driver previously installed, profiles may also be saved in the **Documents and Settings\All Users\Application Data\ nView_Profiles** directory.

- 6 Now you can uninstall your current driver for a driver upgrade.
- 7 After you restart your computer following an NVIDIA new driver install, you can easily load the saved profile from the Profiles page of nView Desktop Manager.

About Using Saved Profiles in Another Computer

You can easily use any saved profile (.tvp file in the `Windows\nView` directory) from one computer and use it in another computer, if you want. You'll need to copy it to the `Windows\nView` directory of a computer that has the NVIDIA ForceWare graphics display driver, etc. installed properly. Then this profile can be loaded from another computer from the nView Desktop Manager Profiles page just as it can from your original computer.

Uninstalling the NVIDIA Display Driver Software

Note: It is highly recommended that you follow the steps in this section to completely uninstall the NVIDIA Display Driver software before updating to a new version of the software.

To uninstall the nView software, follow these steps:

- 1 From the Windows taskbar, click **Start > Settings > Control Panel** to open the Control Panel window.
- 2 Double-click the **Add/Remove Programs** item.
- 3 Click the **NVIDIA Display Driver** item from the list.
- 4 Click **Change/Remove**.
- 5 Click **Yes** to continue.

A prompt appears asking whether you want to delete all of the saved nView profiles.

- If you click **Yes**, all of the nView software and all of your saved profiles will be deleted.
- If you click **No**, the nView software is removed, but the profile files are saved in the `Windows\nView` directory on your hard disk.

Your system now restarts.

Installing the NVIDIA ForceWare Graphics Drivers

- 1 Follow the instructions on the NVIDIA.com Web site driver download page to locate the appropriate driver to download, based on your hardware and operating system.
- 2 Click the driver download link.
The license agreement dialog box appears.
- 3 Click **Accept** if you accept the terms of the agreement, then either open the file or save the file to your PC and open it later.
Opening the EXE file launches the NVIDIA InstallShield Wizard.
- 4 Follow the instructions in the NVIDIA InstallShield Wizard to complete the installation.

NVIDIA Driver History

Release 169 is the latest NVIDIA driver available. [Table 3.2](#) contains a summary of some previous driver releases and the versions associated with them. Some versions listed may not have been released outside of NVIDIA.

Table 3.2 NVIDIA Drivers for Windows

Driver	Name	Versions	Comments
Release 169	ForceWare	169.39, 169.47, 169.55, 169.96	
Release 162	ForceWare	162.50, 162.62, 162.65, 162.67	
Release 160	ForceWare	160.02	
Release 95	ForceWare	95.97, 96.02,97.78	
Release 90	ForceWare	91.36, 91.85,	
Release 80	ForceWare	81.67, 84.26,	
Release 75	ForceWare	77.37, 77.56	
Release 70	ForceWare	71.84, 71.89	
Release 65	ForceWare	66.77, 66.93, 67.02, 67.03, 67.66	
Release 60	ForceWare	61.76, 61.77	
Release 55	ForceWare	56.64, 56.72, 57.30	
Release 50	ForceWare	52.16, 53.04	
Release 40	Detonator FX	44.03–45.xx	
Release 40	Detonator 40	40.60–44.02	
Release 35	Detonator 35	35.60–37.80	
Release 25	Detonator 25	26.00–32.90	
Release 20	Detonator XP	21.83–23.xx	
Release 10	Detonator 3 v1x.xx	10.00–17.xx	

APPENDIX



MODE SUPPORT FOR WINDOWS

This chapter details the Windows modes supported by the Release 169 driver for NVIDIA products. It contains these sections:

- “General Mode Support Information” on page 32
- “Default Modes Supported by GPU for Windows XP” on page 33
- “TV-Out Modes Supported by TV Encoders” on page 47

General Mode Support Information

The NVIDIA graphics driver includes a standard list of display modes that are supported by default. These modes are listed in the section “[Default Modes Supported by GPU for Windows XP](#)” on page 33.

The actual modes available depend on the capabilities of the display. In addition, the NVIDIA graphics driver has a “dynamic EDID detection” capability and will make available *additional* modes that are listed in the display EDID, provided the graphics hardware can support it.

The NVIDIA graphics driver also supports the high resolutions available with the displays listed in [Table A.1](#) as well as the non-standard modes listed in [Table A.2](#).

Table A.1 Modes Supported for High Resolution Displays

Display	Maximum Resolution	Hardware Requirements
HP LP3065 Flat Panel Monitor (Dual-link DVI)	2560×1600 @ 60 Hz	<ul style="list-style-type: none"> All high-end NVIDIA Quadro FX graphics solutions.
Apple 30" Cinema HD Display (Dual link DVI)	2560×1600 @ 60 Hz	<ul style="list-style-type: none"> All high-end NVIDIA Quadro FX graphic solutions.
Dell WFP 3007 (Dual Link DVI)	2560×1600 @ 60 Hz	<ul style="list-style-type: none"> All High-end NVIDIA Quadro FX graphic solutions.

Table A.2 Non-standard Modes Supported

Resolution
1680 x 1050
1366 x 768

Default Modes Supported by GPU for Windows XP

This section lists the modes that are included by default in the driver INF for the following product families:

- “NVIDIA Quadro FX Family of High End GPUs” on page 34
- “NVIDIA Quadro FX Family of GPUs” on page 41

Understanding the Mode Format

Figure A.1 gives an example of how to read the mode information presented in this section.

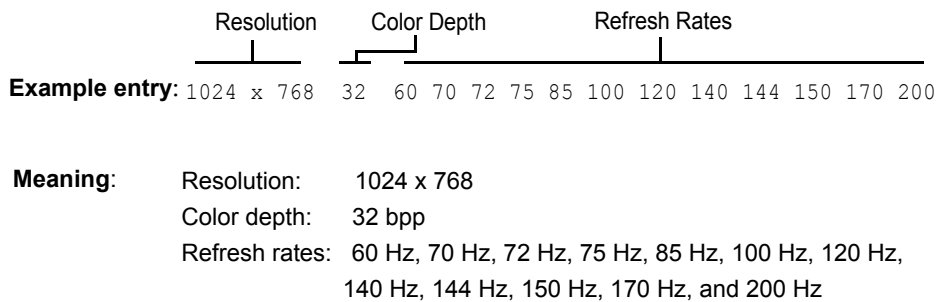


Figure A.1 Mode Format

Note:

- Horizontal spanning modes of 3840x1080 and above, and vertical spanning modes of 1920x2160 and above generally require at least 32 MB of video memory at 32 bpp.
- An “i” next to the refresh rate indicates an interlaced refresh rate.

NVIDIA Quadro FX Family of High End GPUs

This sections lists the supported display resolutions, color depths, and refresh rates for the following products:

- NVIDIA Quadro FX 5600
- NVIDIA Quadro FX 4600
- NVIDIA Quadro FX 5500
- NVIDIA Quadro FX 4500 X2
- NVIDIA Quadro FX 4500
- NVIDIA Quadro FX 3400 / Quadro FX 4400
- NVIDIA Quadro FX 4000
- NVIDIA Quadro FX 3700
- NVIDIA Quadro FX 3500
- NVIDIA Quadro FX 3450 / Quadro FX 4000 SDI
- NVIDIA Quadro FX 1300/3000
- NVIDIA Quadro FX 1700
- NVIDIA Quadro FX 1500
- NVIDIA Quadro FX 1400
- NVIDIA Quadro FX 700
- NVIDIA Quadro FX 570
- NVIDIA Quadro FX 560
- NVIDIA Quadro FX 550
- NVIDIA Quadro FX 540
- NVIDIA Quadro FX 370
- NVIDIA Quadro NVS 440
- NVIDIA Quadro NVS 290
- NVIDIA Quadro NVS 285

////////////////////////////////////

Standard Modes

640 x 480	8		60 70 72 75 85 100 120 140 144 150 170 200 240
720 x 480	8		60
720 x 576	8	50	60
800 x 600	8		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 480	8		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 600	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 768	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 864	8		60 70 72 75 85 100 120 140 144 150 170 200
1280 x 720	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 768	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 800	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 960	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 1024	8		60 70 72 75 85 100 120 140 144 150 170
1360 x 768	8		60 70 72 75 85 100 120 140 144 150 170
1440 x 900	8		60 70 72 75 85 100 120 140 144 150 170 200
1600 x 900	8		60 70 72 75 85 100 120
1600 x 1200	8		60 70 72 75 85 100 120
1680 x 1050	8		60
1920 x 1080	8	30i	60 70 72 75 85 100
1920 x 1200	8		60 70 72 75 85 100
1920 x 1440	8		60 70 72 75 85
2048 x 1536	8		60 70 72 75 85

640 x 480	16		60 70 72 75 85 100 120 140 144 150 170 200 240
720 x 480	16		60
720 x 576	16	50	60
800 x 600	16		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 480	16		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 600	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 768	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 864	16		60 70 72 75 85 100 120 140 144 150 170 200
1280 x 720	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 768	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 800	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 960	16		60 70 72 75 85 100 120 140 144 150 170

APPENDIX A: Mode Support for Windows Default Modes Supported by GPU for Windows

1280 x 1024	16		60 70 72 75 85 100 120 140 144 150 170
1360 x 768	16		60 70 72 75 85 100 120 140 144 150 170
1440 x 900	16		60 70 72 75 85 100 120 140 144 150 170 200
1600 x 900	16		60 70 72 75 85 100 120
1600 x 1200	16		60 70 72 75 85 100 120
1680 x 1050	16		60
1920 x 1080	16	30i	60 70 72 75 85 100
1920 x 1200	16		60 70 72 75 85 100
1920 x 1440	16		60 70 72 75 85
2048 x 1536	16		60 70 72 75 85

640 x 480	32		60 70 72 75 85 100 120 140 144 150 170 200 240
720 x 480	32		60
720 x 576	32	50	60
800 x 600	32		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 480	32		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 600	32		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 768	32		60 70 72 75 85 100 120 140 144 150 170 200
1152 x 864	32		60 70 72 75 85 100 120 140 144 150 170 200
1280 x 720	32		60 70 72 75 85 100 120 140 144 150
1280 x 768	32		60 70 72 75 85 100 120 140 144 150
1280 x 800	32		60 70 72 75 85 100 120 140 144 150
1280 x 960	32		60 70 72 75 85 100 120 140 144 150
1280 x 1024	32		60 70 72 75 85 100 120 140 144 150
1360 x 768	32		60 70 72 75 85 100 120 140 144 150
1440 x 900	32		60 70 72 75 85 100 120 140 144 150 170 200
1600 x 900	32		60 70 72 75 85 100
1600 x 1200	32		60 70 72 75 85 100
1680 x 1050	32		60
1920 x 1080	32	30i	60 70 72 75 85
1920 x 1200	32		60 70 72 75 85
1920 x 1440	32		60 70 72 75 85
2048 x 1536	32		60 70 72 75 85

Horizontal Spanning Modes

1280 x 480	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1600 x 600	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1696 x 480	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1920 x 600	8		60 70 72 75 85 100 120 140 144 150 170 200 240
2048 x 768	8		60 70 72 75 85 100 120 140 144 150 170 200 240
2304 x 864	8		60 70 72 75 85 100 120 140 144 150 170 200
2560 x 720	8		60 70 72 75 85 100 120 140 144 150 170
2560 x 768	8		60 70 72 75 85 100 120 140 144 150 170
2560 x 800	8		60 70 72 75 85 100 120 140 144 150 170
2560 x 960	8		60 70 72 75 85 100 120 140 144 150 170
2560 x 1024	8		60 70 72 75 85 100 120 140 144 150 170
2720 x 768	8		60 70 72 75 85 100 120 140 144 150 170
2880 x 900	8		60 70 72 75 85 100 120 140 144 150 170 200
3200 x 900	8		60 70 72 75 85 100 120
3200 x 1200	8		60 70 72 75 85 100 120
3360 x 1050	8		60
3840 x 1080	8	30i	60 70 72 75 85 100
3840 x 1200	8		60 70 72 75 85 100
3840 x 1440	8		60 70 72 75 85
4096 x 1536	8		60 70 72 75 85

1280 x 480	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1600 x 600	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1696 x 480	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1920 x 600	16		60 70 72 75 85 100 120 140 144 150 170 200 240
2048 x 768	16		60 70 72 75 85 100 120 140 144 150 170 200 240
2304 x 864	16		60 70 72 75 85 100 120 140 144 150 170 200
2560 x 720	16		60 70 72 75 85 100 120 140 144 150 170
2560 x 768	16		60 70 72 75 85 100 120 140 144 150 170
2560 x 800	16		60 70 72 75 85 100 120 140 144 150 170
2560 x 960	16		60 70 72 75 85 100 120 140 144 150 170
2560 x 1024	16		60 70 72 75 85 100 120 140 144 150 170
2720 x 768	16		60 70 72 75 85 100 120 140 144 150 170
2880 x 900	16		60 70 72 75 85 100 120 140 144 150 170 200
3200 x 900	16		60 70 72 75 85 100 120
3200 x 1200	16		60 70 72 75 85 100 120
3360 x 1050	16		60

APPENDIX A: Mode Support for Windows Default Modes Supported by GPU for Windows

3840 x 1080	16	30i	60 70 72 75 85 100
3840 x 1200	16		60 70 72 75 85 100
3840 x 1440	16		60 70 72 75 85
4096 x 1536	16		60 70 72 75 85

1280 x 480	32		60 70 72 75 85 100 120 140 144 150 170 200 240
1600 x 600	32		60 70 72 75 85 100 120 140 144 150 170 200 240
1696 x 480	32		60 70 72 75 85 100 120 140 144 150 170 200 240
1920 x 600	32		60 70 72 75 85 100 120 140 144 150 170 200 240
2048 x 768	32		60 70 72 75 85 100 120 140 144 150 170 200
2304 x 864	32		60 70 72 75 85 100 120 140 144 150 170 200
2560 x 720	32		60 70 72 75 85 100 120 140 144 150
2560 x 768	32		60 70 72 75 85 100 120 140 144 150
2560 x 800	32		60 70 72 75 85 100 120 140 144 150
2560 x 960	32		60 70 72 75 85 100 120 140 144 150
2560 x 1024	32		60 70 72 75 85 100 120 140 144 150
2720 x 768	32		60 70 72 75 85 100 120 140 144 150
2880 x 900	32		60 70 72 75 85 100 120 140 144 150 170 200
3200 x 900	32		60 70 72 75 85 100
3200 x 1200	32		60 70 72 75 85 100
3360 x 1050	32		60
3840 x 1080	32	30i	60 70 72 75 85
3840 x 1200	32		60 70 72 75 85
3840 x 1440	32		60 70 72 75 85
4096 x 1536	32		60 70 72 75 85

Vertical Spanning Modes

640 x 960	8		60 70 72 75 85 100 120 140 144 150 170 200 240
800 x 1200	8		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 960	8		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 1200	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 1536	8		60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 1728	8		60 70 72 75 85 100 120 140 144 150 170 200
1280 x 1440	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 1536	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 1600	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 1920	8		60 70 72 75 85 100 120 140 144 150 170
1280 x 2048	8		60 70 72 75 85 100 120 140 144 150 170
1360 x 1536	8		60 70 72 75 85 100 120 140 144 150 170
1440 x 1800	8		60 70 72 75 85 100 120 140 144 150 170 200
1600 x 1800	8		60 70 72 75 85 100 120
1600 x 2400	8		60 70 72 75 85 100 120
1680 x 2100	8		60
1920 x 2160	8	30i	60 70 72 75 85 100
1920 x 2400	8		60 70 72 75 85 100
1920 x 2880	8		60 70 72 75 85
2048 x 3072	8		60 70 72 75 85

640 x 960	16		60 70 72 75 85 100 120 140 144 150 170 200 240
800 x 1200	16		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 960	16		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 1200	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 1536	16		60 70 72 75 85 100 120 140 144 150 170 200 240
1152 x 1728	16		60 70 72 75 85 100 120 140 144 150 170 200
1280 x 1440	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 1536	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 1600	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 1920	16		60 70 72 75 85 100 120 140 144 150 170
1280 x 2048	16		60 70 72 75 85 100 120 140 144 150 170
1360 x 1536	16		60 70 72 75 85 100 120 140 144 150 170
1440 x 1800	16		60 70 72 75 85 100 120 140 144 150 170 200
1600 x 1800	16		60 70 72 75 85 100 120
1600 x 2400	16		60 70 72 75 85 100 120
1680 x 2100	16		60

APPENDIX A: Mode Support for Windows Default Modes Supported by GPU for Windows

1920 x 2160	16	30i	60 70 72 75 85 100
1920 x 2400	16		60 70 72 75 85 100
1920 x 2880	16		60 70 72 75 85
2048 x 3072	16		60 70 72 75 85

640 x 960	32		60 70 72 75 85 100 120 140 144 150 170 200 240
800 x 1200	32		60 70 72 75 85 100 120 140 144 150 170 200 240
848 x 960	32		60 70 72 75 85 100 120 140 144 150 170 200 240
960 x 1200	32		60 70 72 75 85 100 120 140 144 150 170 200 240
1024 x 1536	32		60 70 72 75 85 100 120 140 144 150 170 200
1152 x 1728	32		60 70 72 75 85 100 120 140 144 150 170 200
1280 x 1440	32		60 70 72 75 85 100 120 140 144 150
1280 x 1536	32		60 70 72 75 85 100 120 140 144 150
1280 x 1600	32		60 70 72 75 85 100 120 140 144 150
1280 x 1920	32		60 70 72 75 85 100 120 140 144 150
1280 x 2048	32		60 70 72 75 85 100 120 140 144 150
1360 x 1536	32		60 70 72 75 85 100 120 140 144 150
1440 x 1800	32		60 70 72 75 85 100 120 140 144 150 170 200
1600 x 1800	32		60 70 72 75 85 100
1600 x 2400	32		60 70 72 75 85 100
1680 x 2100	32		60
1920 x 2160	32	30i	60 70 72 75 85
1920 x 2400	32		60 70 72 75 85
1920 x 2880	32		60 70 72 75 85
2048 x 3072	32		60 70 72 75 85

NVIDIA Quadro FX Family of GPUs

This sections lists the supported display resolutions, color depths, and refresh rates for the following products:

- NVIDIA Quadro FX 2000
- NVIDIA Quadro FX 1000
- NVIDIA Quadro NVS 280 PCI
- NVIDIA Quadro FX 500/FX 600
- NVIDIA Quadro FX 1100
- NVIDIA Quadro FX 330

Standard Modes

640 x 480	8		60	70	72	75	85	100	120	140	144	150	170	200	240
720 x 480	8		60												
720 x 576	8		50	60											
800 x 600	8		60	70	72	75	85	100	120	140	144	150	170	200	240
848 x 480	8		60	70	72	75	85	100	120	140	144	150	170	200	240
960 x 600	8		60	70	72	75	85	100	120	140	144	150	170	200	240
960 x 1200	8			61											
1024 x 768	8		60	70	72	75	85	100	120	140	144	150	170	200	240
1152 x 864	8		60	70	72	75	85	100	120	140	144	150	170	200	
1280 x 720	8		60	70	72	75	85	100	120	140	144	150	170		
1280 x 768	8		60	70	72	75	85	100	120	140	144	150	170		
1280 x 800	8		60	70	72	75	85	100	120	140	144	150	170		
1280 x 960	8		60	70	72	75	85	100	120	140	144	150	170		
1280 x 1024	8		60	70	72	75	85	100	120	140	144	150	170		
1360 x 768	8		60	70	72	75	85	100	120	140	144	150	170		
1600 x 900	8		60	70	72	75	85	100	120						
1600 x 1200	8		60	70	72	75	85	100	120						
1920 x 1080	8	30i	60	70	72	75	85	100							
1920 x 1200	8		60	70	72	75	85	100							
1920 x 1440	8		60	70	72	75	85								
2048 x 1536	8		60	70	72	75	85								

640 x 480	16		60	70	72	75	85	100	120	140	144	150	170	200	240
720 x 480	16		60												

APPENDIX A: Mode Support for Windows Default Modes Supported by GPU for Windows

720 x 576	16		50	60															
800 x 600	16			60	70	72	75	85	100	120	140	144	150	170	200	240			
848 x 480	16			60	70	72	75	85	100	120	140	144	150	170	200	240			
960 x 600	16			60	70	72	75	85	100	120	140	144	150	170	200	240			
960 x 1200	16																		
1024 x 768	16			60	70	72	75	85	100	120	140	144	150	170	200	240			
1152 x 864	16			60	70	72	75	85	100	120	140	144	150	170	200				
1280 x 720	16			60	70	72	75	85	100	120	140	144	150	170					
1280 x 768	16			60	70	72	75	85	100	120	140	144	150	170					
1280 x 800	16			60	70	72	75	85	100	120	140	144	150	170					
1280 x 960	16			60	70	72	75	85	100	120	140	144	150	170					
1280 x 1024	16			60	70	72	75	85	100	120	140	144	150	170					
1360 x 768	16			60	70	72	75	85	100	120	140	144	150	170					
1600 x 900	16			60	70	72	75	85	100	120									
1600 x 1200	16			60	70	72	75	85	100	120									
1920 x 1080	16	30i		60	70	72	75	85	100										
1920 x 1200	16			60	70	72	75	85	100										
1920 x 1440	16			60	70	72	75	85											
2048 x 1536	16			60	70	72	75	85											

640 x 480	32			60	70	72	75	85	100	120	140	144	150	170	200	240			
720 x 480	32			60															
720 x 576	32																		
800 x 600	32			60	70	72	75	85	100	120	140	144	150	170	200	240			
848 x 480	32			60	70	72	75	85	100	120	140	144	150	170	200	240			
960 x 600	32			60	70	72	75	85	100	120	140	144	150	170	200	240			
960 x 1200	32																		
1024 x 768	32			60	70	72	75	85	100	120	140	144	150	170	200				
1088 x 612	32			60	70	72	75	85	100	120	140	144	150	170	200				
1152 x 864	32			60	70	72	75	85	100	120	140	144	150	170	200				
1280 x 720	32			60	70	72	75	85	100	120	140	144	150						
1280 x 768	32			60	70	72	75	85	100	120	140	144	150						
1280 x 800	32			60	70	72	75	85	100	120	140	144	150						
1280 x 960	32			60	70	72	75	85	100	120	140	144	150						
1280 x 1024	32			60	70	72	75	85	100	120	140	144	150						
1360 x 768	32			60	70	72	75	85	100	120	140	144	150						
1600 x 900	32			60	70	72	75	85	100	120									
1600 x 1024	32			60	70	72	75	85	100										
1600 x 1200	32			60	70	72	75	85	100										

1920 x 1080	32	30i	60	70 72 75 85
1920 x 1200	32		60	70 72 75 85
1920 x 1440	32		60	70 72 75 85
2048 x 1536	32		60	70 72 75 85

Horizontal Spanning Modes

1280 x 480	8		60	70 72 75 85 100 120 140 144 150 170 200 240
1600 x 600	8		60	70 72 75 85 100 120 140 144 150 170 200 240
1696 x 480	8		60	70 72 75 85 100 120 140 144 150 170 200 240
1920 x 600	8		60	70 72 75 85 100 120 140 144 150 170 200 240
1920 x 1200	8		61	
2048 x 768	8		60	70 72 75 85 100 120 140 144 150 170 200 240
2304 x 864	8		60	70 72 75 85 100 120 140 144 150 170 200
2560 x 720	8		60	70 72 75 85 100 120 140 144 150 170
2560 x 768	8		60	70 72 75 85 100 120 140 144 150 170
2560 x 800	8		60	70 72 75 85 100 120 140 144 150 170
2560 x 960	8		60	70 72 75 85 100 120 140 144 150 170
2560 x 1024	8		60	70 72 75 85 100 120 140 144 150 170
2720 x 768	8		60	70 72 75 85 100 120 140 144 150 170
3200 x 900	8		60	70 72 75 85 100 120
3200 x 1200	8		60	70 72 75 85 100 120
3840 x 1080	8	30i	60	70 72 75 85 100
3840 x 1200	8		60	70 72 75 85 100
3840 x 1440	8		60	70 72 75 85
4096 x 1536	8		60	70 72 75 85

1280 x 480	16		60	70 72 75 85 100 120 140 144 150 170 200 240
1600 x 600	16		60	70 72 75 85 100 120 140 144 150 170 200 240
1696 x 480	16		60	70 72 75 85 100 120 140 144 150 170 200 240
1920 x 600	16		60	70 72 75 85 100 120 140 144 150 170 200 240
1920 x 1200	16		61	
2048 x 768	16		60	70 72 75 85 100 120 140 144 150 170 200 240
2304 x 864	16		60	70 72 75 85 100 120 140 144 150 170 200
2560 x 720	16		60	70 72 75 85 100 120 140 144 150 170
2560 x 768	16		60	70 72 75 85 100 120 140 144 150 170
2560 x 800	16		60	70 72 75 85 100 120 140 144 150 170
2560 x 960	16		60	70 72 75 85 100 120 140 144 150 170

APPENDIX A: Mode Support for Windows Default Modes Supported by GPU for Windows

2560 x 1024	16		60	70	72	75	85	100	120	140	144	150	170		
2720 x 768	16		60	70	72	75	85	100	120	140	144	150	170		
3200 x 900	16		60	70	72	75	85	100	120						
3200 x 1200	16		60	70	72	75	85	100	120						
3840 x 1080	16	30i	60	70	72	75	85	100							
3840 x 1200	16		60	70	72	75	85	100							
3840 x 1440	16		60	70	72	75	85								
4096 x 1536	16		60	70	72	75	85								

1280 x 480	32		60	70	72	75	85	100	120	140	144	150	170	200	240
1600 x 600	32		60	70	72	75	85	100	120	140	144	150	170	200	240
1696 x 480	32		60	70	72	75	85	100	120	140	144	150	170	200	240
1920 x 600	32		60	70	72	75	85	100	120	140	144	150	170	200	240
1920 x 1200	32			61											
2048 x 768	32		60	70	72	75	85	100	120	140	144	150	170	200	
2176 x 612	32		60	70	72	75	85	100	120	140	144	150	170	200	
2304 x 864	32		60	70	72	75	85	100	120	140	144	150	170	200	
2560 x 720	32		60	70	72	75	85	100	120	140	144	150			
2560 x 768	32		60	70	72	75	85	100	120	140	144	150			
2560 x 800	32		60	70	72	75	85	100	120	140	144	150			
2560 x 960	32		60	70	72	75	85	100	120	140	144	150			
2560 x 1024	32		60	70	72	75	85	100	120	140	144	150			
2720 x 768	32		60	70	72	75	85	100	120	140	144	150			
3200 x 900	32		60	70	72	75	85	100	120						
3200 x 1024	32		60	70	72	75	85	100							
3200 x 1200	32		60	70	72	75	85	100							
3840 x 1080	32	30i	60	70	72	75	85								
3840 x 1200	32		60	70	72	75	85								
3840 x 1440	32		60	70	72	75	85								
4096 x 1536	32		60	70	72	75	85								

Vertical Spanning Modes

640 x 960	8		60	70	72	75	85	100	120	140	144	150	170	200	240
800 x 1200	8		60	70	72	75	85	100	120	140	144	150	170	200	240
848 x 960	8		60	70	72	75	85	100	120	140	144	150	170	200	240
960 x 1200	8		60	70	72	75	85	100	120	140	144	150	170	200	240
1024 x 1536	8		60	70	72	75	85	100	120	140	144	150	170	200	240
1152 x 1728	8		60	70	72	75	85	100	120	140	144	150	170	200	
1280 x 1440	8		60	70	72	75	85	100	120	140	144	150	170		
1280 x 1536	8		60	70	72	75	85	100	120	140	144	150	170		
1280 x 1600	8		60	70	72	75	85	100	120	140	144	150	170		
1280 x 1920	8		60	70	72	75	85	100	120	140	144	150	170		
1280 x 2048	8		60	70	72	75	85	100	120	140	144	150	170		
1360 x 1536	8		60	70	72	75	85	100	120	140	144	150	170		
1600 x 1800	8		60	70	72	75	85	100	120						
1600 x 2400	8		60	70	72	75	85	100	120						
1920 x 2160	8	30i	60	70	72	75	85	100							
1920 x 2400	8		60	70	72	75	85	100							
1920 x 2880	8		60	70	72	75	85								
2048 x 3072	8		60	70	72	75	85								

640 x 960	16		60	70	72	75	85	100	120	140	144	150	170	200	240
800 x 1200	16		60	70	72	75	85	100	120	140	144	150	170	200	240
848 x 960	16		60	70	72	75	85	100	120	140	144	150	170	200	240
960 x 1200	16		60	70	72	75	85	100	120	140	144	150	170	200	240
1024 x 1536	16		60	70	72	75	85	100	120	140	144	150	170	200	240
1152 x 1728	16		60	70	72	75	85	100	120	140	144	150	170	200	
1280 x 1440	16		60	70	72	75	85	100	120	140	144	150	170		
1280 x 1536	16		60	70	72	75	85	100	120	140	144	150	170		
1280 x 1600	16		60	70	72	75	85	100	120	140	144	150	170		
1280 x 1920	16		60	70	72	75	85	100	120	140	144	150	170		
1280 x 2048	16		60	70	72	75	85	100	120	140	144	150	170		
1360 x 1536	16		60	70	72	75	85	100	120	140	144	150	170		
1600 x 1800	16		60	70	72	75	85	100	120						
1600 x 2400	16		60	70	72	75	85	100	120						
1920 x 2160	16	30i	60	70	72	75	85	100							
1920 x 2400	16		60	70	72	75	85	100							
1920 x 2880	16		60	70	72	75	85								
2048 x 3072	16		60	70	72	75	85								

```

-----
640 x 960 32          60   70 72 75 85 100 120 140 144 150 170 200 240
800 x 1200 32        60   70 72 75 85 100 120 140 144 150 170 200 240
848 x 960 32         60   70 72 75 85 100 120 140 144 150 170 200 240
960 x 1200 32        60   70 72 75 85 100 120 140 144 150 170 200 240
1024 x 1536 32       60   70 72 75 85 100 120 140 144 150 170 200
1088 x 1224 32       60   70 72 75 85 100 120 140 144 150 170 200
1152 x 1728 32       60   70 72 75 85 100 120 140 144 150 170 200
1280 x 1440 32       60   70 72 75 85 100 120 140 144 150
1280 x 1536 32       60   70 72 75 85 100 120 140 144 150
1280 x 1600 32       60   70 72 75 85 100 120 140 144 150
1280 x 1920 32       60   70 72 75 85 100 120 140 144 150
1280 x 2048 32       60   70 72 75 85 100 120 140 144 150
1360 x 1536 32       60   70 72 75 85 100 120 140 144 150
1600 x 1800 32       60   70 72 75 85 100 120
1600 x 2048 32       60   70 72 75 85 100
1600 x 2400 32       60   70 72 75 85 100
1920 x 2160 32 30i   60   70 72 75 85
1920 x 2400 32       60   70 72 75 85
1920 x 2880 32       60   70 72 75 85
2048 x 3072 32       60   70 72 75 85

```

TV-Out Modes Supported by TV Encoders

Table A.3 and Table A.4 list the NTSC, PAL, and HDTV TV-Out modes supported by the NVIDIA driver.

Table A.3 Mode Support for S-Video and Composite Out

Resolution	Bit depth	Comments
320x200	8, 16, 32	DirectDraw mode; not selectable as a Windows desktop
320x240	8, 16, 32	DirectDraw mode; not selectable as a Windows desktop
640x400	8, 16, 32	DirectDraw mode; not selectable as a Windows desktop
640x480	8, 16, 32	
720x480	8, 16, 32	Overscans (for video)
720x576	8, 16, 32	Overscans (for video)
800x600	8, 16, 32	
1024x768	8, 16, 32	Conexant 25871 only

Table A.4 Mode Support for Component YPrPb Out and DVI Out

Resolution	Comments
480i (SDTV)	Supported on graphics boards with Conexant 875 or Philips 7108 TV encoders and compatible connectors, and compatible GeForce 6 Series and GeForce 7 Series GPUs.
480p (EDTV)	
720p (HDTV)	
1080i (HDTV)	
576i (PAL)	
576p (PAL)	

The driver supports manual overscan correction for component and DVI outputs. See the *ForceWare Graphics Driver User's Guide* for instructions on how to use the overscan correction features in the control panel.